



the play inspection company

Annual Inspection

Pendle Borough Council

Salterforth

Moor Lane, Salterforth, Barnoldswick, Lancashire, BB18
5SP



API Associate

Unit 5, Glenmore Business Park, Blackhill Road, Poole, Dorset, BH16 6NL
t- 01202 590675 e- info@playinspections.co.uk

www.playinspections.co.uk



Risk Assessment Matrix

		Scores in the report are multiplication factors of Likelihood x Severity						
		Severity>>						
Likelihood	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	VL (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	VL (2)	VL (3)	VL (4)	VL (5)
			Very Low	Low	Moderate	High	Very High	
			1	2	3	4	5	
			No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Serious injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality	
			Severity>>					
			<p>Note 1: The total risk scores included within our reports are a multiplication factor of the calculated Likelihood and Severity of each finding. Both Likelihood and Severity are given a number between 1 - 5 as shown on the matrix above and these two numbers are then multiplied together to give the total risk score that is shown against defects on the report. Total risk scores can be divided in both directions, i.e. a total risk score of 12 could be a Likelihood (3) x Severity (4) or Likelihood (4) x Severity (3).</p>					
			<p>Note 2: When we inspect we only see a snapshot of the current condition of the equipment. It is the operators responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.</p>					

Equipment has been assessed to the following standards where relevant:

- BS EN 1176 Parts 1-11 (Playground equipment and surfacing)
- BS EN 14974 (Facilities for users of roller sports equipment)
- BS EN 15312 (Free access multi-sports equipment)
- BS EN 16899 (Parkour Equipment)
- BS EN 16630 (Outdoor Fitness Equipment).

Inspection Scope for RPII Inspection Methodology

This document outlines the RPII scope for inspections undertaken by the Inspectors listed as Annual Inspectors on the RPII Register of Inspectors when undertaking Indoor Annual, Outdoor Annual, Outdoor Operational and Outdoor Routine inspections.

Inspections are undertaken with reference to the standards listed in this preamble only; where no date for the standard is given it will be the standard that is current at the time of inspection except where overlap periods are granted by the standards committee when standards are updated. The information contained in reports is provided to assist the owner/operator in fulfilling their responsibilities as detailed in the relevant standard. Other standards referenced within the listed standards do not form part of the inspection, unless they are also explicitly listed here.

The following standards are relevant to all installations of equipment that are publicly accessible to users; this includes public parks, pay and play parks, schools, nurseries, public houses, holiday parks, indoor play centres, farm parks etc. All equipment used or employed in publicly accessible areas should meet with the requirements of the relevant standards (listed below):

BS EN 1176 Parts 1, 2, 3, 4, 5, 6, 10 & 11 Playground equipment intended for permanent installation outdoors & indoors.

BS EN 1176 Part 7 - 'Guidance on Installation, Inspection, Maintenance and Operation' (this document gives guidance to the owners/operators of the facility on the installation, inspection, maintenance and operation of playground equipment, excluding ancillary items).

In the United Kingdom the National Foreword forms an important part to the understanding and implementation of the recommendations set out in this document. It clarifies the application of the document within the UK as best practice guidance, as the document has been used since its initial publication. Therefore, in the UK this standard (BS EN 1176 – Part 7) contains no requirements and needs to be read and implemented as guidance, with the use of the term 'shall' therefore becoming a recommendation, as in the term 'should'.

Domestic play equipment falls outside of the scope of BS EN 1176 and has its own standards (BS EN 71 series – Safety of Toys). Where domestic equipment can be identified this will be acknowledged in the report but any comments concerning compliance will follow the requirements and recommendations of BS EN 1176.

When water play items, including spray parks, are inspected any comments concerning compliance within the inspection will refer to BS EN 1176. We have not assessed these against the requirements of BS EN 17232 (Water play equipment and features).

Other equipment that is not clearly identified as unsupervised or domestic (natural play, self-build equipment etc.) will be assessed for compliance with the relevant standard listed below:

BS EN 15312 Free access multi-sports equipment

BS EN 14974 Skateparks

BS EN 16630 Permanently installed outdoor fitness equipment

BS EN 16899 Parkour equipment (plus RPII/API guidance notes)

Annual and Post Installation inspections will take into consideration compliance with these current standards, and defects related to wear and vandalism. Items not listed in the report have not been included in the inspection. The inspection will cover the playground equipment and the active area (that area which is obviously part of the playground), nominally up to three metres around, the fence line if closer, or other areas as agreed.

Operational inspections only take into consideration defects related to cleanliness, equipment ground clearances, ground surface finishes, exposed foundations, sharp edges, missing parts, excessive wear (of moving parts) structural integrity, wear and vandalism.

Routine visual inspections relate only to the most obvious defects such as broken or missing parts, litter, vandalism and issues created by severe weather conditions (the intention is to identify hazards created by storm damage).

All inspections are non-dismantling, non-destructive and do not include any structural, toxicology or impact assessments defined in the standard; however, the inspector will undertake a manual test for stability and if equipment fails under manual load, or any other hazard is identified as an unacceptable risk, the owner/operator will be notified as soon as practicable possible.

The inspector will access all reasonably accessible equipment and will assess all reasonably accessible parts above the standing surface. Where it is not possible to access parts of the equipment without employing an alternative means of access the report will record the action required by the owner/operator to ensure the continued safe use of the equipment.

Ancillary equipment will be assessed using the inspector's knowledge and experience of the standards named in this document. (Note: Ancillary items are not included in the specific equipment-type parts of the EN 1176 series; hence they are not assessed for compliance with EN 1176 series and are subject to a general safety assessment).

The owner/operator is responsible for the overall safety of the equipment and area.

The inspector will not undertake any of the following works unless specifically agreed in writing at the time of order:

Checking the depth and underlying structural integrity of any surface areas and/or carrying out any testing of the impact attenuating properties of any surfaces; the identification of any corrosion, rot or other deterioration in any apparatus or equipment other than by an external inspection; the inspection of any equipment (or part thereof) that is beneath the playing surface (loose-fill materials may be moved to expose foundations); tightening any bolts, hinges or other fixing devices on any apparatus or equipment; assessing or inspecting any electrical installations contained on any site and/or apparatus and/or equipment; assessing or inspecting any water supplies and/or water features and/or any associated computerised systems (including carrying out any programming); where planting or trees are mentioned in the report no assessments of toxicity, suitability or condition are undertaken – the owner/operator should have suitable inspections provided by a competent person.

The owner/operator should have a 'design risk assessment' provided by the manufacturer/designer of the area for the equipment and location in which the facility is installed.

The operator is responsible for managing risks of their provision and is required by law to carry out a 'suitable and sufficient assessment' of the risks associated with a site or activity. This inspection shall be considered as contributing to the operator's discharge of this responsibility.

The details contained within the report are a snapshot of the condition at the time of inspection only and subsequent events may affect the condition of the facility. Suggested remedial actions are based on the knowledge and experience of the inspector and/or that of the inspection company. The owner/operator should always seek the advice of the manufacturer or a competent person when undertaking repairs and/or modifications to equipment.

A full copy of the Play Inspection Company Ltd. Terms & Conditions is available on our website (www.playinspections.co.uk)

The operator is responsible for following the guidance of the relevant standards. The standards give guidance on the installation, inspection, maintenance and operation of the various types of facilities. The inspection guidance is listed in Table 1, with an indication of which parts will be included in an RPII Annual or Post-Installation Inspection. The relevant standards also contain additional parts which the operator should follow.

Inspection recommendations of relevant standards Refer to relevant standards for full text	Annual Main	RPII Annual/ Post Installation Inspection
6.1 d) Overall levels of safety of equipment (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of foundations (see note 1)	✓	✓ [1]
6.1 d) Overall levels of safety of playing surfaces (see note 2)	✓	✓ [2]
6.1 d) Compliance with the relevant parts of the standard and or risk assessment (see note 3)	✓	✓ [3]
6.1 d) Effects of weather	✓	✓
6.1 d) Presence of rot, decay or corrosion (see note 1)	✓	✓ [1]
6.1 d) Assessment of repairs made or added or replaced components (see note 4)	✓	✓ [4]
6.1 d) Excavation or dismantling/additional measures	✓	✗
6.2.1 Assessment of glass reinforced plastics (see note 5)	✓	✓ [5]
6.2.1 Inspection of one post equipment (see note 1)	✓	✓ [1]
6.2.4 Undertaking the Operators inspection protocol	✓	✗

NB: The clause numbers in table 1 are taken from BS EN 1176 - Part 7:2020. The content is equally applicable to all other relevant standards listed herein. Playgrounds contain a range of equipment from different manufacturers and installed over a number of years; operators should implement any guidance provided by the manufacturer. Item specific detail is not readily available to RPII Playground Inspectors, whose report contributes to the operator's overall Annual Main Inspection as detailed in the relevant standards.

[1] A manual test only is undertaken for stability. Wear and instability are only detectable where readily apparent without dismantling or destruction and without the use of tools, excavation or specialist equipment. Rot and corrosion are tested or with a hammer and/or steel rod. Decay in timber may exist which can only be found with specialist equipment.

[2] Only the visible condition and dimensional compliance of surface extent is considered. Neither testing of impact attenuating properties nor measurement of the thickness of bound surfaces are undertaken on RPII annual inspections.

[3] The inspection assesses compliance where this can be tested on site using manual methods without dismantling, destruction and without the use of tools or specialist equipment.

[4] The operator should use manufacturer's recommended parts, or equivalent. We are unable to verify if such parts have been used, and any subsequent change in quality or performance.

[5] Visible glass fibres will be noted in reports. The operator is responsible for repairs or replacement.



The Play Inspection Company Ltd
Unit 5 Glenmore Business Park
Blackhill Road
Poole
Dorset
BH16 6NL
01202 590675

Salterforth

Inspection Ref: 2440951

Site Ref: 9410

Inspected: 8-August-2024 - 10:48 by Robert Walters (RPII Annual Inspector)

Risk Assessment: **8 Low Risk**



Location:

The site is located in an area of public open space and is overlooked by a number of properties in the local community.

Disabled Access:

Some accessible features; an area that presents difficulties to the majority of people with disabilities but in favourable circumstances and certainly in partnership can be accessed.



8 - Low Risk

Item: Site General
Manufacturer: Owner/Operator
Surface Type: N/A
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 4



Finding 1

Sand has migrated on to the surfaces - Clean and maintain

Finding 2

There is weed / vegetation growth on, between, or around the edges of the surfacing - Remove weed / vegetation growth

Finding 3

There is algae, silt or moss growth on the surface resulting in slippery conditions - Clean and treat appropriately

Finding 4

NOTE - Some asset photographs may not show the full item due to children being present at the time of inspection. The inspector has taken care to ensure that no faces are present within the images. --

5 - Very Low Risk

Item: Sign
Manufacturer: Owner/Operator
Surface Type: N/A
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

BS EN 1176 Part 7 recommends that signage shall include the site name / address - Provide additional information



8 - Low Risk	
Item:	Gate - Self Closing
Manufacturer:	Not Identified
Surface Type:	Bitmac
Item Quantity:	2
Equipment Compliance:	N/A
Surface Area Compliance:	N/A
Total Findings:	4
Finding 1	Finding 2
The area under the gate has eroded leaving uneven areas, or the concrete foundations exposed, resulting in trip hazards at the entrance/exit to the playground - Reinstate to level with surrounding surfaces	The item has been damaged - Monitor for any further deterioration and replace as required
Finding 3	Finding 4
There are openings that are less than 12mm that could trap or crush fingers - Provide a 12mm gap throughout full range of motion at both sides of gate	The gate/s was / were locked or secured at the time of the inspection and a full inspection could not be undertaken - Complete inspection of gate/s when re-opened

4 - Very Low Risk	
Item:	Gate - Maintenance
Manufacturer:	Not Identified
Surface Type:	Bitmac
Item Quantity:	1
Equipment Compliance:	N/A
Surface Area Compliance:	N/A
Total Findings:	1
Finding 1	
The maintenance gate was correctly padlocked at the time of inspection, however this means that the inspector was unable to fully assess the gate - Ensure that there are 12mm gaps throughout the full range of motion on gate/s and between leaves where relevant	



 4 - Very Low Risk

Item:	Stone Wall
Manufacturer:	Not Identified
Surface Type:	Bitmac
Item Quantity:	1
Equipment Compliance:	N/A
Surface Area Compliance:	N/A
Total Findings:	1



Finding 1
This item is satisfactory - no work required -

 8 - Low Risk

Item:	Fencing - Timber
Manufacturer:	Not Identified
Surface Type:	Grass
Item Quantity:	1
Equipment Compliance:	N/A
Surface Area Compliance:	N/A
Total Findings:	2



Finding 1
There are a number of loose posts around the fence - Monitor for any further deterioration and reset as required

Finding 2
There are projecting bolt thread(s) present - Remove excess thread length and deburr or provide cap



The Play Inspection Company Ltd
Unit 5 Glenmore Business Park
Blackhill Road
Poole
Dorset
BH16 6NL
01202 590675



4 - Very Low Risk

Item: Bench
Manufacturer: Not Identified
Surface Type: Bitmac
Item Quantity: 7
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -



4 - Very Low Risk

Item: Picnic Table
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 1
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -



4 - Very Low Risk

Item: Litter Bin
Manufacturer: Not Identified
Surface Type: Grass
Item Quantity: 3
Equipment Compliance: N/A
Surface Area Compliance: N/A

Total Findings: 1

Finding 1
There is some graffiti present - Remove the graffiti

8 - Low Risk

Item: Goalmouth and Basketball Post
Manufacturer: Parkdale Play & Leisure Ltd
Surface Type: Tarmac
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: N/A
Life Expectancy: 5 -10 Years
Total Findings: 3

Finding 1
The paintwork on this item has been damaged or worn exposing the metal underneath which is rusting / corroding - Treat affected areas and repaint

Finding 2
There is or are fixings missing on the item - Replace all missing fixings

Finding 3
There is or are fixings missing on the backboard - Replace all missing fixings

6 - Low Risk

Item:	Multi Play (Junior)
Manufacturer:	Parkdale Play & Leisure Ltd
Surface Type:	Wet Pour
Item Quantity:	1
Equipment Compliance:	No
Surface Area Compliance:	Yes
Life Expectancy:	5 -10 Years
Total Findings:	5



Finding 1

There are a number of dents in the slide surface - Monitor for any further deterioration and repair as required

Finding 2

The connecting links are in excess of 8.6mm and less than 12mm and fail the requirements of BS EN 1176 Part 1; clause 4.2.13, Chains - Monitor use and replace with compliant links at the next maintenance cycle

Finding 3

The paintwork on this item has been damaged or worn exposing the metal underneath which is rusting / corroding - Treat affected areas and repaint

Finding 4

There is/are bolt cap covers missing or damaged on the item - Replace missing or damaged bolt cap covers

Finding 5

The ropes/nets are worn/damaged in places - Monitor for any further deterioration and repair or replace as required

4 - Very Low Risk

Item:	Spring Crazy Daisy
Manufacturer:	Not Identified
Surface Type:	Grass
Item Quantity:	1
Equipment Compliance:	Yes
Surface Area Compliance:	Yes
Life Expectancy:	5 -10 Years
Total Findings:	1



Finding 1

This item is satisfactory - no work required -



6 - Low Risk

Item: Multi Play (Toddler)
Manufacturer: Hags
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: Yes
Surface Area Compliance: Yes
Life Expectancy: 5 -10 Years
Total Findings: 5



Finding 1

There are gaps opening between the surfacing and the edging surround or between the joints in the surfacing - Monitor for any further deterioration and repair as required

Finding 3

The item has been damaged - Monitor for any further deterioration and replace as required

Finding 5

There is/are bolt cap covers missing or damaged on the item - Replace missing or damaged bolt cap covers

Finding 2

A number of fixing(s) have worked loose - Secure all loose fixings

Finding 4

There is some graffiti present - Remove the graffiti



8 - Low Risk

Item: 2 Bay 4 Seat (Flat)
Manufacturer: Wicksteed Playgrounds
Surface Type: Wet Pour
Item Quantity: 1
Equipment Compliance: No
Surface Area Compliance: Yes
Life Expectancy: 5 -10 Years
Total Findings: 6



Finding 1

The bushes are worn or missing - Replace worn or missing bushes

Finding 3

There is some notable evidence of chain wear - Monitor for any further deterioration and replace when 40% worn

Finding 5

The chain openings are in excess of 8.6mm and do not meet the recommendations of BS EN 1176 Part 1 - Monitor - No remedial work recommended

Finding 2

There is some wear to the shackles - Monitor for any further deterioration and replace when 40% worn

Finding 4

The seat has minor damage or wear - Monitor for any further deterioration and replace as required

Finding 6

The seats are too close to each other as defined in BS EN 1176 Part 2; this is a low risk failure and no remedial action is required - Monitor - No remedial work recommended



6 - Low Risk	
Item:	Spring Bike
Manufacturer:	Ledon
Surface Type:	Wet Pour
Item Quantity:	1
Equipment Compliance:	No
Surface Area Compliance:	Yes
Life Expectancy:	5 -10 Years
Total Findings:	4
Finding 1	Finding 2
The end of handgrips and/or footrests have a cross section of less than 15cm ² and fail to meet the requirements of BS EN 1176 Part 6 - Monitor - No remedial work recommended	The U bolts clamping the spring are worn - Monitor for any further deterioration and replace as required
Finding 3	Finding 4
The paintwork on the spring has been damaged or worn exposing the metal underneath which is rusting - Treat any rusting components and repaint	The footrest has been damaged - Monitor for any further deterioration and replace as required

4 - Very Low Risk	
Item:	Spring See-Saw
Manufacturer:	Fahr Industries
Surface Type:	Wet Pour
Item Quantity:	1
Equipment Compliance:	Yes
Surface Area Compliance:	Yes
Life Expectancy:	5 -10 Years
Total Findings:	1
Finding 1	
The U bolts clamping the spring are worn - Monitor for any further deterioration and replace as required	



The Play Inspection Company Ltd
Unit 5 Glenmore Business Park
Blackhill Road
Poole
Dorset
BH16 6NL
01202 590675

4 - Very Low Risk

Item:	Sand Play Area
Manufacturer:	Not Identified
Surface Type:	Sand
Item Quantity:	1
Equipment Compliance:	N/A
Surface Area Compliance:	N/A
Life Expectancy:	5 -10 Years
Total Findings:	1



Finding 1

This item is satisfactory - no work required -

6 - Low Risk

Item:	1 Bay 2 Seat (Cradle)
Manufacturer:	Wicksteed Playgrounds
Surface Type:	Wet Pour
Item Quantity:	1
Equipment Compliance:	No
Surface Area Compliance:	No
Life Expectancy:	5 -10 Years
Total Findings:	4



Finding 1

The bushes are showing signs of wear - Monitor for any further deterioration and replace as required

Finding 2

There is some wear to the shackles - Monitor for any further deterioration and replace when 40% worn

Finding 3

The chain openings are in excess of 8.6mm and do not meet the recommendations of BS EN 1176 Part 1 - Monitor - No remedial work recommended

Finding 4

The surfacing dimensions are short and do not meet with the requirements of the current applicable standard - Monitor - no remedial action recommended



The Play Inspection Company Ltd
Unit 5 Glenmore Business Park
Blackhill Road
Poole
Dorset
BH16 6NL
01202 590675

4 - Very Low Risk

Item:	Excavator
Manufacturer:	Hags
Surface Type:	Sand
Item Quantity:	1
Equipment Compliance:	Yes
Surface Area Compliance:	N/A
Life Expectancy:	5 -10 Years
Total Findings:	1

Finding 1
This item is satisfactory - no work required -





The Play Inspection Company Ltd
Unit 5 Glenmore Business Park
Blackhill Road
Poole
Dorset
BH16 6NL
01202 590675

Findings information

8 - Low Risk (Finding 1)	
Item: Ancillary Items - Site General	Risk Level: L - Low Risk
Manufacturer: Owner/Operator	Surface: N/A
	
Finding: Sand has migrated on to the surfaces	Action: Clean and maintain



6 - Low Risk (Finding 2)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: L - Low Risk
Surface: N/A



Finding: There is weed / vegetation growth on, between, or around the edges of the surfacing **Action:** Remove weed / vegetation growth



8 - Low Risk (Finding 3)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: L - Low Risk
Surface: N/A



Finding: There is algae, silt or moss growth on the surface resulting in slippery conditions **Action:** Clean and treat appropriately



The Play Inspection Company Ltd
Unit 5 Glenmore Business Park
Blackhill Road
Poole
Dorset
BH16 6NL
01202 590675



0 - Risk Assessment not Undertaken (Finding 4)

Item: Ancillary Items - Site General
Manufacturer: Owner/Operator

Risk Level: N - Risk Assessment not Undertaken
Surface: N/A



NO IMAGE
APPLICABLE

Finding: NOTE - Some asset photographs may not show the full item due to children being present at the time of inspection. The inspector has taken care to ensure that no faces are present within the images.

Action: -

Information icon (blue circle with white 'i') 5 - Very Low Risk (Finding 1)

Item: Ancillary Items - Sign
Manufacturer: Owner/Operator

Risk Level: V - Very Low Risk
Surface: N/A



NO IMAGE
APPLICABLE

Finding: BS EN 1176 Part 7 recommends that signage shall include the site name / address

Action: Provide additional information

8 - Low Risk (Finding 1)			
Item:	Gates - Gate - Self Closing	Risk Level:	L - Low Risk
Manufacturer:	Not Identified	Surface:	Bitmac
		Finding: The area under the gate has eroded leaving uneven areas, or the concrete foundations exposed, resulting in trip hazards at the entrance/exit to the playground	
Action: Reinstate to level with surrounding surfaces			

6 - Low Risk (Finding 2)			
Item:	Gates - Gate - Self Closing	Risk Level:	L - Low Risk
Manufacturer:	Not Identified	Surface:	Bitmac
		Finding: The item has been damaged	
Action: Monitor for any further deterioration and replace as required			



The Play Inspection Company Ltd
Unit 5 Glenmore Business Park
Blackhill Road
Poole
Dorset
BH16 6NL
01202 590675



8 - Low Risk (Finding 3)

Item: Gates - Gate - Self Closing
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Bitmac



Finding: There are openings that are less than 12mm that could trap or crush fingers

Action: Provide a 12mm gap throughout full range of motion at both sides of gate



0 - Risk Assessment not Undertaken (Finding 4)

Item: Gates - Gate - Self Closing
Manufacturer: Not Identified

Risk Level: N - Risk Assessment not Undertaken
Surface: Bitmac



Finding: The gate/s was / were locked or secured at the time of the inspection and a full inspection could not be undertaken

Action: Complete inspection of gate/s when re-opened



4 - Very Low Risk (Finding 1)

Item: Gates - Gate - Maintenance	Risk Level: V - Very Low Risk
Manufacturer: Not Identified	Surface: Bitmac

Finding: The maintenance gate was correctly padlocked at the time of inspection, however this means that the inspector was unable to fully assess the gate

Action: Ensure that there are 12mm gaps throughout the full range of motion on gate/s and between leaves where relevant

6 - Low Risk (Finding 1)

Item: Fences - Fencing - Timber	Risk Level: L - Low Risk
Manufacturer: Not Identified	Surface: Grass

Finding: There are a number of loose posts around the fence

Action: Monitor for any further deterioration and reset as required



8 - Low Risk (Finding 2)

Item: Fences - Fencing - Timber
Manufacturer: Not Identified

Risk Level: L - Low Risk
Surface: Grass



Finding: There are projecting bolt thread(s) present

Action: Remove excess thread length and deburr or provide cap



4 - Very Low Risk (Finding 1)

Item: Ancillary Items - Litter Bin
Manufacturer: Not Identified

Risk Level: V - Very Low Risk
Surface: Grass



Finding: There is some graffiti present

Action: Remove the graffiti



The Play Inspection Company Ltd
Unit 5 Glenmore Business Park
Blackhill Road
Poole
Dorset
BH16 6NL
01202 590675



6 - Low Risk (Finding 1)

Item: Multi Use Games Area - Goalmouth and Basketball Post
Manufacturer: Parkdale Play & Leisure Ltd

Risk Level: L - Low Risk
Surface: Tarmac



Finding: The paintwork on this item has been damaged or worn exposing the metal underneath which is rusting / corroding

Action: Treat affected areas and repaint



8 - Low Risk (Finding 2)

Item: Multi Use Games Area - Goalmouth and Basketball Post
Manufacturer: Parkdale Play & Leisure Ltd

Risk Level: L - Low Risk
Surface: Tarmac



Finding: There is or are fixings missing on the item

Action: Replace all missing fixings



The Play Inspection Company Ltd
Unit 5 Glenmore Business Park
Blackhill Road
Poole
Dorset
BH16 6NL
01202 590675



8 - Low Risk (Finding 3)

Item: Multi Use Games Area - Goalmouth and Basketball Post
Manufacturer: Parkdale Play & Leisure Ltd

Risk Level: L - Low Risk
Surface: Tarmac



Finding: There is or are fixings missing on the backboard


Action: Replace all missing fixings



4 - Very Low Risk (Finding 1)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Parkdale Play & Leisure Ltd

Risk Level: V - Very Low Risk
Surface: Wet Pour

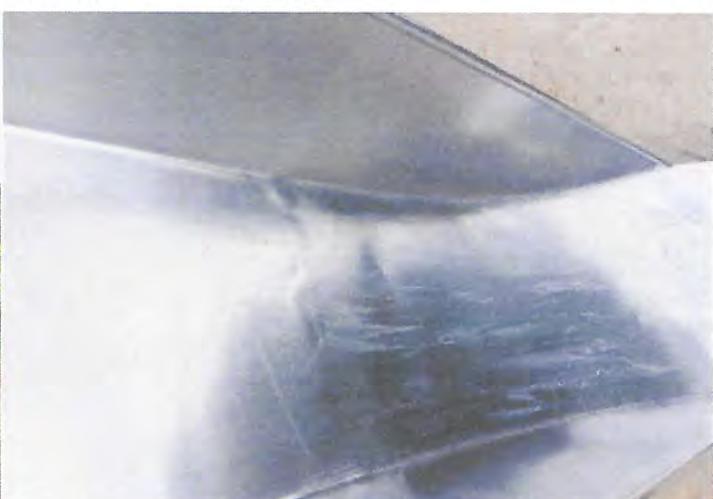

Finding: There are a number of dents in the slide surface

Action: Monitor for any further deterioration and repair as required



5 - Very Low Risk (Finding 2)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Parkdale Play & Leisure Ltd

Risk Level: V - Very Low Risk
Surface: Wet Pour



Finding: The connecting links are in excess of 8.6mm and less than 12mm and fail the requirements of BS EN 1176 Part 1; clause 4.2.13, Chains

Action: Monitor use and replace with compliant links at the next maintenance cycle



6 - Low Risk (Finding 3)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Parkdale Play & Leisure Ltd

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: The paintwork on this item has been damaged or worn exposing the metal underneath which is rusting / corroding


Action: Treat affected areas and repaint



4 - Very Low Risk (Finding 4)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Parkdale Play & Leisure Ltd

Risk Level: V - Very Low Risk
Surface: Wet Pour

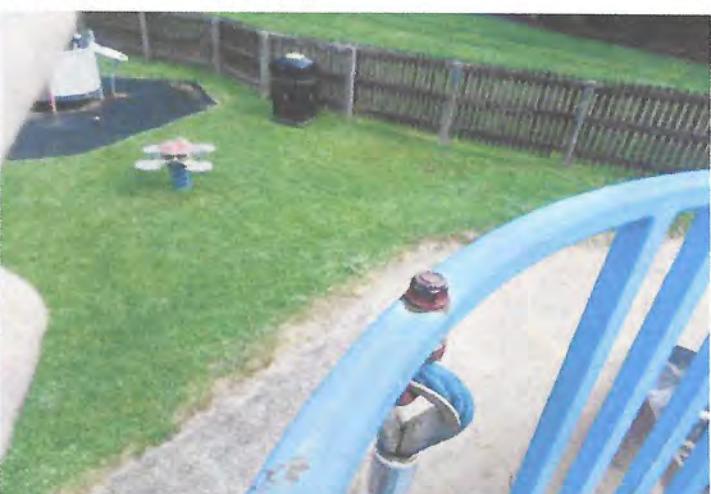

Finding: There is/are bolt cap covers missing or damaged on the item


Action: Replace missing or damaged bolt cap covers



6 - Low Risk (Finding 5)

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Parkdale Play & Leisure Ltd

Risk Level: L - Low Risk
Surface: Wet Pour

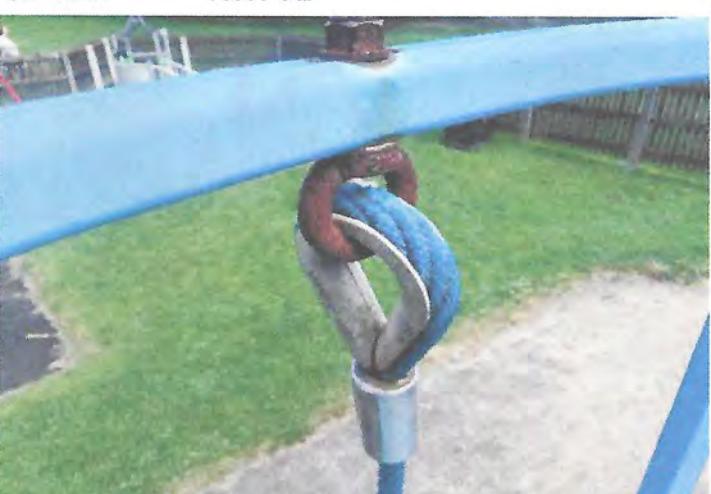


Finding: The ropes/nets are worn/damaged in places

Action: Monitor for any further deterioration and repair or replace as required

6 - Low Risk (Finding 1)

Item: Activity Equipment - Multi Play (Toddler)
Manufacturer: Hags

Risk Level: L - Low Risk
Surface: Wet Pour

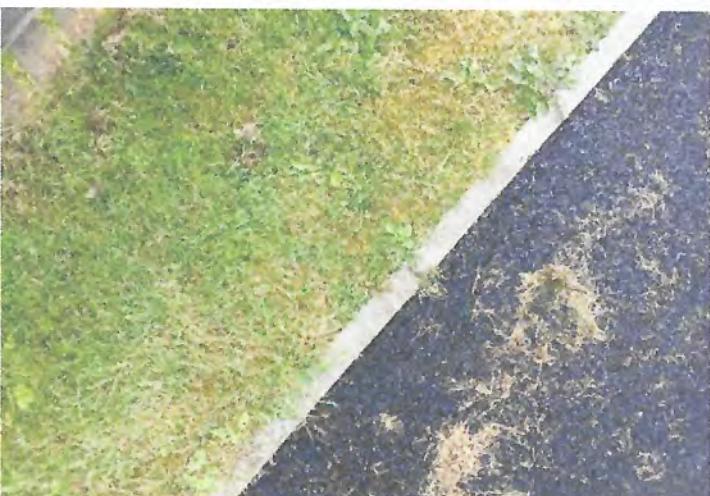

Finding: There are gaps opening between the surfacing and **Action:** Monitor for any further deterioration and repair as the edging surround or between the joints in the surfacing required

6 - Low Risk (Finding 2)

Item: Activity Equipment - Multi Play (Toddler)
Manufacturer: Hags

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: A number of fixing(s) have worked loose

Action: Secure all loose fixings

6 - Low Risk (Finding 3)

Item: Activity Equipment - Multi Play (Toddler)
Manufacturer: Hags

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: The item has been damaged

Action: Monitor for any further deterioration and replace as required

0 - Risk Assessment not Undertaken (Finding 4)

Item: Activity Equipment - Multi Play (Toddler)
Manufacturer: Hags

Risk Level: N - Risk Assessment not Undertaken
Surface: Wet Pour



Finding: There is some graffiti present

Action: Remove the graffiti

 4 - Very Low Risk (Finding 5)	Item: Activity Equipment - Multi Play (Toddler) Manufacturer: Hags	Risk Level: V - Very Low Risk Surface: Wet Pour
		

Finding: There is/are bolt cap covers missing or damaged **Action:** Replace missing or damaged bolt cap covers on the item

 8 - Low Risk (Finding 1)	Item: Swings - 2 Bay 4 Seat (Flat) Manufacturer: Wicksteed Playgrounds	Risk Level: L - Low Risk Surface: Wet Pour
		

Finding: The bushes are worn or missing **Action:** Replace worn or missing bushes



6 - Low Risk (Finding 2)

Item: Swings - 2 Bay 4 Seat (Flat)
Manufacturer: Wicksteed Playgrounds

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: There is some wear to the shackles

Action: Monitor for any further deterioration and replace when 40% worn



6 - Low Risk (Finding 3)

Item: Swings - 2 Bay 4 Seat (Flat)
Manufacturer: Wicksteed Playgrounds

Risk Level: L - Low Risk
Surface: Wet Pour



Finding: There is some notable evidence of chain wear

Action: Monitor for any further deterioration and replace when 40% worn

	6 - Low Risk (Finding 4)
Item: Swings - 2 Bay 4 Seat (Flat) Manufacturer: Wicksteed Playgrounds	Risk Level: L - Low Risk Surface: Wet Pour
Finding: The seat has minor damage or wear	Action: Monitor for any further deterioration and replace as required

	5 - Very Low Risk (Finding 5)
Item: Swings - 2 Bay 4 Seat (Flat) Manufacturer: Wicksteed Playgrounds	Risk Level: V - Very Low Risk Surface: Wet Pour
Finding: The chain openings are in excess of 8.6mm and do not meet the recommendations of BS EN 1176 Part 1	Action: Monitor - No remedial work recommended

 4 - Very Low Risk (Finding 6)

Item: Swings - 2 Bay 4 Seat (Flat)
Manufacturer: Wicksteed Playgrounds

Risk Level: V - Very Low Risk
Surface: Wet Pour



Finding: The seats are too close to each other as defined in **Action:** Monitor - No remedial work recommended
 BS EN 1176 Part 2; this is a low risk failure and no remedial action is required

 6 - Low Risk (Finding 1)

Item: Rocking Equipment - Spring Bike
Manufacturer: Ledon


Risk Level: L - Low Risk
Surface: Wet Pour



Finding: The end of handgrips and/or footrests have a cross section of less than 15cm² and fail to meet the requirements of BS EN 1176 Part 6
Action: Monitor - No remedial work recommended



The Play Inspection Company Ltd
Unit 5 Glenmore Business Park
Blackhill Road
Poole
Dorset
BH16 6NL
01202 590675

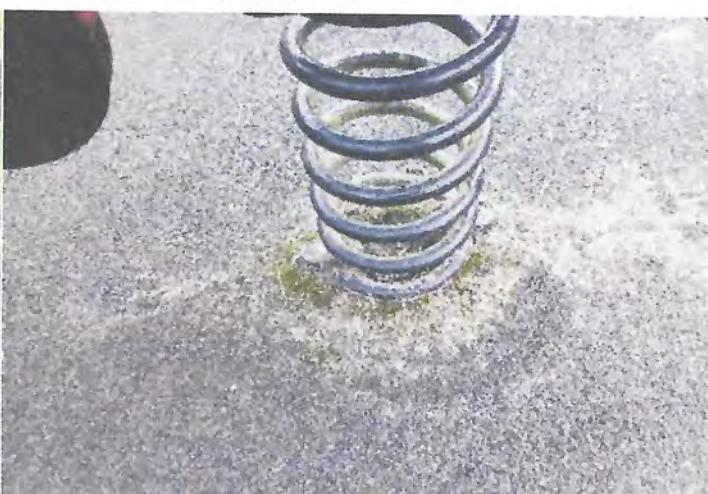4 - Very Low Risk (Finding 2)	
Item: Rocking Equipment - Spring Bike Manufacturer: Ledon	Risk Level: V - Very Low Risk Surface: Wet Pour
	
Finding: The U bolts clamping the spring are worn	Action: Monitor for any further deterioration and replace as required

6 - Low Risk (Finding 3)	
Item: Rocking Equipment - Spring Bike Manufacturer: Ledon	Risk Level: L - Low Risk Surface: Wet Pour
	
Finding: The paintwork on the spring has been damaged or worn exposing the metal underneath which is rusting	Action: Treat any rusting components and repaint



6 - Low Risk (Finding 4)

Item: Rocking Equipment - Spring Bike
Manufacturer: Ledon



Risk Level: L - Low Risk
Surface: Wet Pour



Finding: The footrest has been damaged

Action: Monitor for any further deterioration and replace as required



4 - Very Low Risk (Finding 1)

Item: Rocking Equipment - Spring See-Saw
Manufacturer: Fahr Industries



Risk Level: V - Very Low Risk
Surface: Wet Pour



Finding: The U bolts clamping the spring are worn

Action: Monitor for any further deterioration and replace as required

4 - Very Low Risk (Finding 1)	
Item: Swings - 1 Bay 2 Seat (Cradle) Manufacturer: Wicksteed Playgrounds	Risk Level: V - Very Low Risk Surface: Wet Pour
	
Finding: The bushes are showing signs of wear	Action: Monitor for any further deterioration and replace as required

6 - Low Risk (Finding 2)	
Item: Swings - 1 Bay 2 Seat (Cradle) Manufacturer: Wicksteed Playgrounds	Risk Level: L - Low Risk Surface: Wet Pour
	
Finding: There is some wear to the shackles	Action: Monitor for any further deterioration and replace when 40% worn



The Play Inspection Company Ltd
Unit 5 Glenmore Business Park
Blackhill Road
Poole
Dorset
BH16 6NL
01202 590675

5 - Very Low Risk (Finding 3)	
Item: Swings - 1 Bay 2 Seat (Cradle)	Risk Level: V - Very Low Risk
Manufacturer: Wicksteed Playgrounds	Surface: Wet Pour
	
Finding: The chain openings are in excess of 8.6mm and do not meet the recommendations of BS EN 1176 Part 1	Action: Monitor - No remedial work recommended



The Play Inspection Company Ltd
Unit 5 Glenmore Business Park
Blackhill Road
Poole
Dorset
BH16 6NL
01202 590675

5 - Very Low Risk (Finding 4)	
Item: Swings - 1 Bay 2 Seat (Cradle) Manufacturer: Wicksteed Playgrounds	Risk Level: V - Very Low Risk Surface: Wet Pour
	
	
Finding: The surfacing dimensions are short and do not meet with the requirements of the current applicable standard	Action: Monitor - no remedial action recommended